

C&DH

CAUTION
ALARM


Prime NCS
Detected RT Fail
MDM FGB-2(1) -
FGB

Nominal Config:
Channel Swapping
Enabled

PCS Node1: N1-2:
UB_Orb-N1-2

N1_2_MDM_UB_
ORB_N1_2_Ch_Sw_
Inhib_Stat - ena

PRIME NCS DETECTED RT FAIL MDM FGB-2(1) - FGB

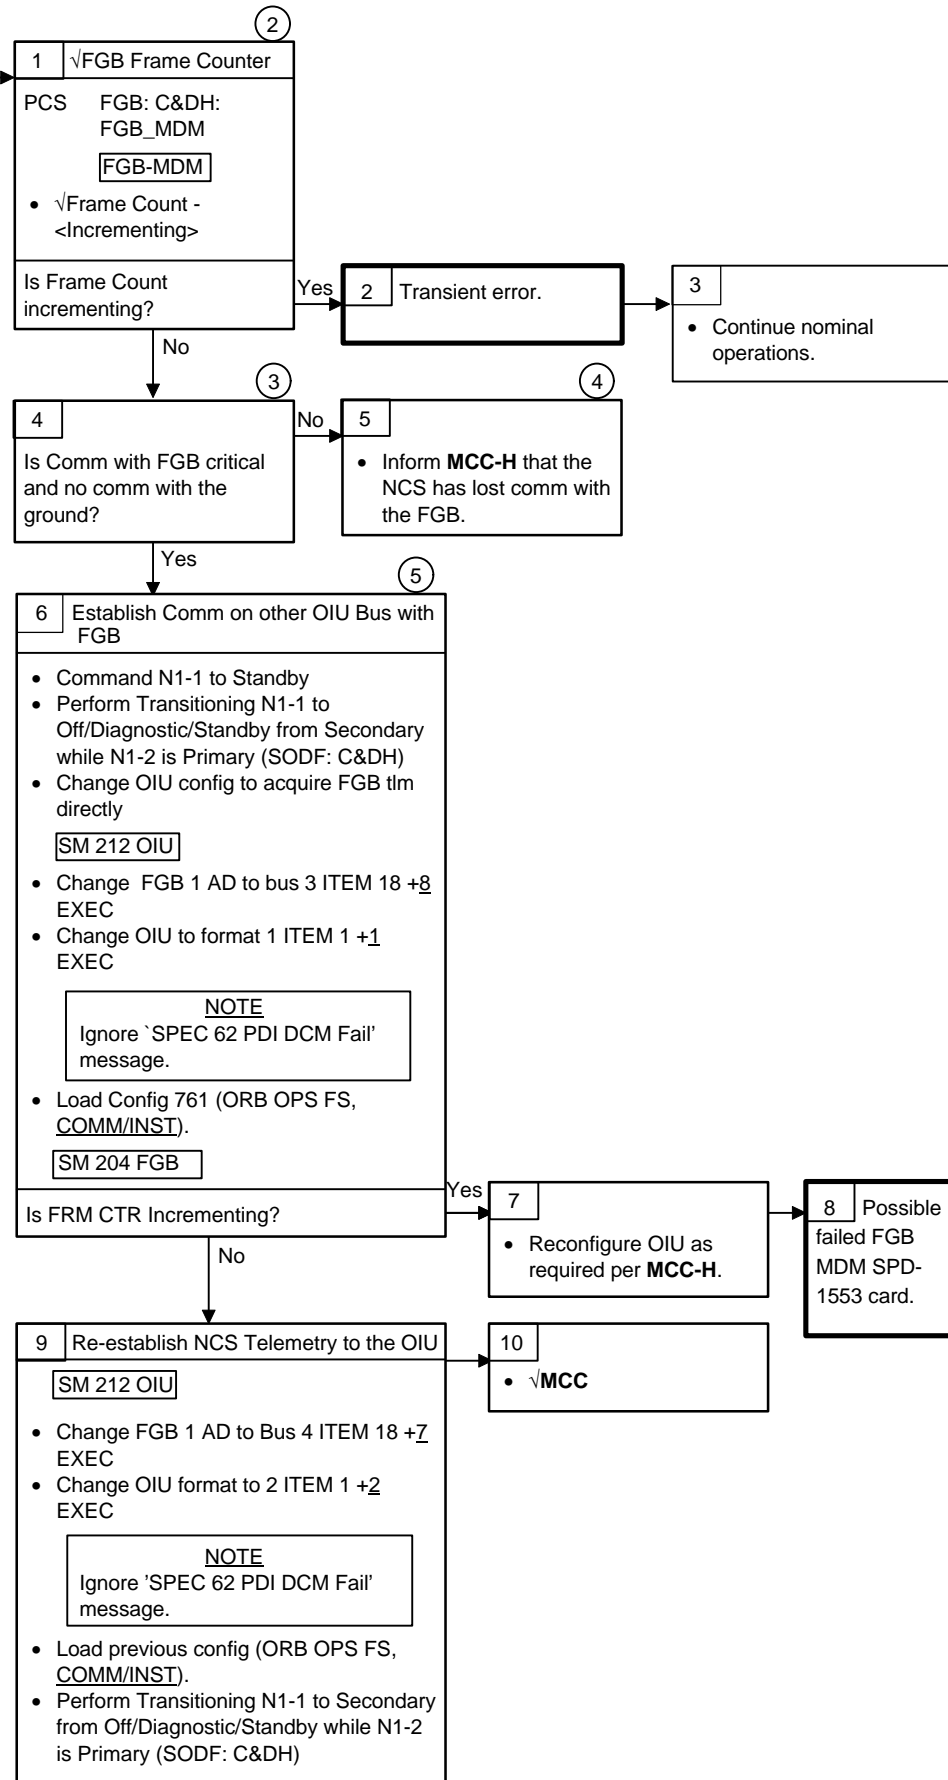

① Error message indicates that the FGB frame count has not updated.

② NCS software will search for 60 seconds until comm is established with either FGB.

③ Comm is critical if FGB commands or telemetry is required to complete a time critical procedure.

④ MCC-M may reset current FGB-MDM, or swap to other FGB MDM.

⑤ This step will cause loss of NCS telemetry to the ground, loss of NCS telemetry to NCS SPEC, and loss of secondary NCS telemetry.

This Page Intentionally Blank